

VALID INFOTAINMENT SYSTEM MY2023-2024 VO.6.28 RELEASE NOTES

Introduction

This document provides information about the Valid Infotainment System revision history for model year, as well as outstanding identified issues with interim solutions.

Revision History

Revision	Issue Resolved / Feature Added
v06.28	 In full-screen camera view, Valid Infotainment display no longer freezes upon reactivation from sleep state.
	 Improved Ethernet network stability after a cold start.
	 Fuse detection has been added, with alerts displayed for blown fuses.
	 Sygic software has been updated to improve calculations for long-distance route planning.
	 Leveling messaging improved - status is now displayed properly when leveling process is complete.

VDC01087 REV E FEB 2025 PAGE 1 OF 3

VALID INFOTAINMENT SYSTEM OPERATION MANUAL

Revision	Issue Resolved / Feature Added
v06.22	VNC and Sygic software has been updated:
	 GPS position loss has been corrected.
	 New navigation features have been added, including lane departure pop-up and improvements to preference list and route planning.
	 Audible navigation prompts have been improved.
	 Clean screen option has been moved to the top of the settings menu.
	 Issues with audio source selection on the passenger touchscreen have been fixed
	 Audio volume now returns to the previous level and source after a call is ended or declined.
	 VNC module firmware can now be updated from the infotainment screen.
	Stability issues that have been resolved:
	 Main and overhead displays now have enhanced stability.
	 Bluetooth® performance improved when source is unexpectedly disconnected.
	 The video decoder for the overhead display has been updated to v5:
	 Improves the network traffic.
	 Prevents a screen lockup should the decoder send a bad message.
	 Reduced audible speaker feedback during system reboot.
	The network menu display of the Sygic software version has been corrected.
	 The SiriusXM® parental lock icon has been reduced in size.

VDC01087 REV E FEB 2025 PAGE 2 OF 3

OPERATION MANUAL

Known Issues

The table below lists conditions that may be encountered even after the Valid Infotainment System firmware is updated to v0.6.28, as well as possible solutions.

Issue	Interim Fix
Bluetooth® audio controls from phone for Valid Infotainment System audio do not function.	No interim fix available at this time.
No camera feed on either the Valid Instrument Cluster or the Valid Infotainment screen.	HDMI-to-IP Encoder must be reset.
GPS navigation does not start.	Double-tap the Sygic icon to launch the app.
Camera view does not change with signal light (Anthem / Cornerstone).	The Delta Mobile camera controller must be updated.

VDC01087 REV E FEB 2025 PAGE 3 OF 3