

## VALID INFOTAINMENT SYSTEM MY2025 VO.0.30 RELEASE NOTES

## Introduction

This document contains information about the Valid Infotainment System revision history for model year 2025, as well as outstanding identified issues with interim solutions.

## **Revision History**

Revision	Issue Resolved / Feature Added	
v0.0.30	VNC and Sygic software has been updated:	
	<ul> <li>GPS position loss has been corrected.</li> </ul>	
	<ul> <li>New navigation features have been added, including lane departure pop-up and improvements to preference list, and route planning.</li> </ul>	
	<ul> <li>Resolved a bug with the Freightliner steering wheel control volume changes.</li> </ul>	
	<ul> <li>Added a CAN diagnostic screen to aid in troubleshooting.</li> </ul>	
	Resolved an Audio screen overlap bug.	
	<ul> <li>Improved audio switching for navigation prompts.</li> </ul>	
	<ul> <li>Reduced audible speaker feedback during system reboot.</li> </ul>	
	<ul> <li>Move the Clean Screen item to the top of the Settings list.</li> </ul>	
	<ul> <li>Resolved audio switching from the passenger touchscreen.</li> </ul>	
	<ul> <li>Improved network error handling to prevent GUI lockup (screen freezing).</li> </ul>	
	<ul> <li>Resolved version display for Sygic software on the network menu.</li> </ul>	
	<ul> <li>Added the ability to update the VNC module through the infotainment screen.</li> </ul>	
	<ul> <li>Main and overhead displays now have enhanced stability.</li> </ul>	
	Bluetooth® performance improved when source is unexpectedly disconnected.	
	<ul> <li>Call volume resolved; Audio will return to the previous level and source after a cal is ended or declined.</li> </ul>	
	<ul> <li>The SiriusXM® parental lock icon has been reduced in size.</li> </ul>	

VDC01416 REV - OCT 2024 PAGE 1 OF 3

VALID INFOTAINMENT SYSTEM OPERATION MANUAL

Revision	Issue Resolved / Feature Added		
v0.0.19	<ul> <li>If the audio is set to a source other than Bluetooth®, any navigation prompts will temporarily mute the audio so the prompts can be heard.</li> </ul>		
	<ul> <li>Echo cancellation source during phone calls has been fixed.</li> </ul>		
	<ul> <li>Volume level is saved during a phone call and restored to that level on the next cal</li> </ul>		
	Bluetooth® auto reconnect has been improved.		
v0.0.16	Sygic software update is now available through the network device list in the settings menu (Settings > Settings > System Information).		
	Bluetooth® functionality improvements have been made:		
	<ul> <li>Cab interface module has been updated to prevent lockout issues on the toll window.</li> </ul>		
	Stability improved upon device removal.		
	For large contact lists:		
	<ul> <li>Stability has been improved.</li> </ul>		
	<ul> <li>Scroll bar added.</li> </ul>		
	Video lag has been reduced.		
	Leveling display improvements have been made:		
	<ul> <li>Bubble display has been fixed.</li> </ul>		
	<ul> <li>Passenger touchscreen firmware has been updated.</li> </ul>		
	<ul> <li>Ride height button has been fixed on dual hydraulic and air suspension systems.</li> </ul>		
	SiriusXM can now be chosen as a source only when available.		
	<ul> <li>Status display of accent light has been fixed.</li> </ul>		
	<ul> <li>Video feed has been stabilized when the vehicle is being started.</li> </ul>		

VDC01416 REV - OCT 2024 PAGE 2 OF 3

OPERATION MANUAL

## **Known Issues**

The table below lists conditions that may be encountered even after the Valid Infotainment System firmware is updated to v0.0.30, as well as possible solutions.

Issue	Interim Fix
GPS doesn't display for a period of up to 1 minute.	GPS is most likely still on Dynamic IP and must be changed to Static IP.
Bluetooth® audio controls from phone for Valid Infotainment System audio do not function.	No interim fix available at this time.
No camera feed on either the Valid Instrument Cluster or the Valid Infotainment screen.	HDMI-to-IP Encoder must be reset.
GPS navigation does not start.	Double-tap the Sygic icon to launch the app.
Camera view does not change with signal light (Anthem / Cornerstone).	The Delta Mobile camera controller must be updated.

VDC01416 REV - OCT 2024 PAGE 3 OF 3